

**SUBJECT :AV-803-1-K-C/CL250-412 installed on Yak-18T aircraft.
Replacement of mounting nuts.**

For owners and users of propeller AV-803-1-K-C/CL250-412 installed on Yak-18T aircraft.

Avia Propeller announces the modification of mounting nuts for propellers AV-803-1-K-C installed on Yak-18T aircraft. It is applied only to propellers stated in table 1 (see page 2) with original flange bolts and washers installed. See figure 1 to observe the difference between the original parts and the new part.

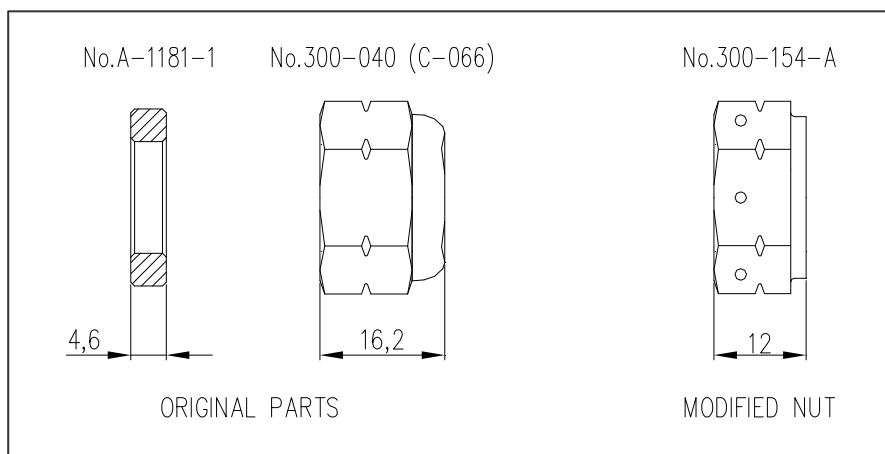


Figure 1 Mounting nuts and washer

It is not necessary to replace original nut by modified nut. However, in case of problem with installation of propeller on the engine by using original parts, use modified nuts to eliminate this problem.

CAUTION:

Modified nuts are designed strictly for using in combination with original flange bolts and washers and can be used only for propellers stated in table 1.

CAUTION:

If modified nuts are used to mount the propeller to the engine, tighten the nuts with torque 95-110 Nm (70-81 lb-ft) and safety the nuts with 0,8mm (0,032inch) stainless steel wire (two bolts per safety).

All owners and users with interest on modified nuts or original washers, ask for these parts at: TECHNOAVIA Ltd. , 5th Magistralnaja, 14 build.1, 123007 Moscow, Russia.

**SERVICE ADVISORY
SA-2**

Propeller S/N	Propeller S/N
070003	070020
070006	070021
070007	070022
070009	070023
070010	070024
070011	070025
070018	070026
070019	070027

Table 1 Propellers AV-803-1-K-C